

18. – 19.11.2020

# **GELMON 2020**

5<sup>th</sup> International Workshop  
on Geoelectric Monitoring



# **GELMON 2020**

**5<sup>th</sup> International Workshop on Geoelectric Monitoring**

## **Book of Abstracts**

**November 18<sup>th</sup> – November 19<sup>th</sup>, 2020**

**Editor:** Birgit Jochum, project manager of GELMON 2020

Berichte der Geologischen Bundesanstalt, Nr. 139, ISSN 1017-8880

## **Recommended citation / Zitiervorschlag**

### Volume / Gesamtwerk

Jochum, B. (Ed.) (2020): GELMON 2020: 5<sup>th</sup> International Workshop on Geoelectric Monitoring: Book of Abstracts: November 18<sup>th</sup> – November 19<sup>th</sup>, 2020. – Berichte der Geologischen Bundesanstalt, 139, 26 S., Wien.

### Article / Einzelartikel

Jochum B., Ottowitz D., Römer A., Bieber G., Pfeiler S. (2020): Geoelectric monitoring during pumping tests. – In: Jochum, B. (Ed.) (2020): GELMON 2020: 5<sup>th</sup> International Workshop on Geoelectric Monitoring: Book of Abstracts: November 18<sup>th</sup> – November 19<sup>th</sup>, 2020. – Berichte der Geologischen Bundesanstalt, 139, 22., Wien.

ISSN 1017-8880

Alle Rechte für In- und Ausland vorbehalten

Medieninhaber und Verleger: Geologische Bundesanstalt, Neulinggasse 38, 1030 Wien

[www.geologie.ac.at](http://www.geologie.ac.at)

Layout: Birgit Jochum

Cover: Installation of a geoelectric monitoring 2020 at the Geological Survey of Austria (Photo Robert Krickl).

Verlags- und Herstellungsort: Wien

Ziel der „Berichte der Geologischen Bundesanstalt“ ist die Verbreitung wissenschaftlicher Ergebnisse.

Satz: Geologische Bundesanstalt

Druck: RIEGELNIK Ges.m.b.H, Piaristengasse 17–19, 1080 Wien

# Electrical and electromagnetic monitoring for engineering applications: a lab test for evaluating the concrete curing phenomenon with 4D-ERT

Luigi Capozzoli<sup>1</sup>, Gregory De Martino<sup>1</sup>, Valeria Giampaolo<sup>1</sup>, Enzo Rizzo<sup>1,2</sup>

(1) *Hydrogeosite Laboratory, National Research Council - Institute of Methodologies for Environmental Analysis (CNR-IMAA), Tito (PZ), Italy*

(2) *University of Ferrara, Ferrara, Italy*


**keywords:** 3-D time-lapse ERT, GPR, concrete curing, water content, non-invasive diagnostic

The variation of the water content of structural elements realized according the reinforced concrete (RC) technology can be effectively monitored with use of electrical and electromagnetic geophysical method. Indeed, presence of water hardly increases electrical conductivity and dielectric constant of the concrete, while its absence or limited presence causes higher electrical resistivity behaviour and a greater velocity of propagation of EM waves.

The experiment consists in the evaluation of potentialities and limits of 4-D non-destructive geophysical techniques for monitoring the concrete curing phenomenon for a month immediately following placing and finishing. In particular, time-lapse 3-D ERT and GPR surveys have been applied to a RC (Concrete C28-35, Steel B450C) panel of sizes 1 x 1 x 0.15 m, as showed in fig. 1.

25 electrodes placed every ten centimetres and distributed on five rows have used to perform geoelectrical measurements using dipole-dipole array and the Syscal Pro (red circles in fig. 1c). The electrical resistivity measurements were repeated every day for one month and measured resistivity data were inverted using the ERTLab 3D software.

Simultaneously, GPR data (2 GHz antenna coupled to SIR 3000 GPR system) were acquired (blue arrows in fig. 1b). The hyperbolas generated by the presence of four rebars of the panel are automatically picked for estimating the dielectric permittivity of the concrete; moreover, the time of the first arrivals was monitored for 30 days.

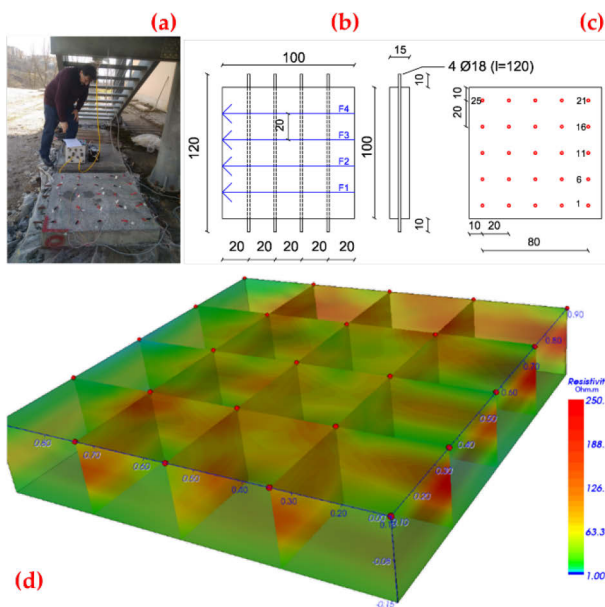

A diffuse increase of the resistivity values due to the curing of the concrete has been detected for the entire volume investigated, except for the lower zones where there is, likely, the accumulation of water (fig. 1d). This is in accordance with the dielectric permittivity variations showing a negative trend related to the evaporation of the water.

**Figure caption:** behavior of the panel recorded with ERT. As expected, the continuous decrease of the water content in the panel monitored for 30 days, caused a constant increase of the electrical resistivity values and EM velocity.